0924 SERIES - PVC BLOCKED TRUE UNION BALL VALVE

FEATURES:


- Grey PVC body, suitable for both schedule 40 & 80 pipe
- Seal material: EPDM o-ring
- Seat material: PTFE
- Double union / double block design permits in-line maintenance without disconnecting pipe
- Ends are blocked with bayonet style lock to prevent ball from being blown out
- Comes complete with both threaded and slip end connections
- Blue ABS handle is equipped with removable spanner device

SPECIFICATIONS:

- Threads conform to ANSI/ASME B1.20.1
- Slip connections conform to ASTM D2466

RATINGS:

- Working Temperature Range: 41°F to 122°F (5°C to 55°C)
- Max Pressure Rating: 150 PSI @ 73°F(22°C)

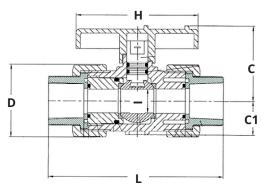



MATERIAL LIST							
Name	Material						
Body	UPVC						
Stem O-ring	EPDM						
Stem	UPVC						
Ball	UPVC						
Ball Seat	PTFE						
End Block O-ring	EPDM						
End Block	UPVC						
Union O-ring	EPDM						
End Connector	UPVC						
Union Nut	UPVC						
Handle	ABS						

DIMENSIONS														
Part I No.	Nominal Size	ı		D		С		C1		L		Н		Weight
		inches	mm	inches	mm	inches	mm	inches	mm	inches	mm	inches	mm	grams
0924-05	1/2"	0.51	13.00	1.77	45.00	1.89	48.00	0.81	20.50	4.49	114.00	3.07	78.00	190
0924-07	3/4"	0.71	18.00	2.17	55.00	2.24	57.00	1.02	26.00	5.31	135.00	3.62	92.00	308
0924-10	1"	0.91	23.00	2.60	66.00	2.60	66.00	1.30	33.00	5.83	148.00	3.94	100.00	467
0924-12	1-1/4"	1.18	30.00	3.23	82.00	2.91	74.00	1.50	38.00	6.61	168.00	4.33	110.00	754
0924-15	1-1/2"	1.50	38.00	3.86	98.00	3.43	87.00	1.57	40.00	6.89	175.00	4.76	121.00	1067
0924-20	2"	1.89	48.00	4.72	120.00	4.25	108.00	2.09	53.00	8.11	206.00	5.79	147.00	1917

Temperature Correction Factor for PVC Valves

As temperature increases, working pressure decreases. The optimal working pressure for PVC valves is 150 PSI @ 73°F (22°C) If the temperature increases above 73°F (22°C), use the PVC correction factor to determine working pressure. Multiply the maximum working pressure by the correction factor.

Temperature	73°F (22°C)	90°F (32°C)	100°F (38°C)	110°F (38°C)	120°F (49°C)	130°F (54°C)	140°F (60°C)
PVC Correction Factor	1.00	1.00	1.00	0.83	0.66	0.50	0.33

For more information on installation, adjustment, repair & operation, visit Boshart Knowledge Base at SUPPORT.BOSHART.COM





25 Whaley Avenue, PO Box 310, Milverton, ON CANADA NOK 1M0



Tel: 800-561-3164

